



Software Version 1.04 Updates

General Updates

Item	Information
Low flow during fill	During start-up, booster pump will be enabled if low flow is detected during tank fill
Sparkling refill	Tank will automatically refill when sparkling button is released
Autofill	Added cold/hot overflow protection in the event of level sensor failure during operation
	Added dip switch 4 functionality: If dip 4 is ON, ION will NEVER fill cold/hot tanks on start-up

Bug Fixes

Item	Information
Hot tank thermistor error (0x35)	Fixed bug that would cause error condition if hot thermistor was too cold "cold startup error"
	Fixed bug that could falsely report over-temp alarm when higher temperature setpoint is selected
Factory reset	Fixed bug that would cause filter to reset when performing a factory reset
Booster pump timeout	Fixed bugs that would prevent booster pump from turning off
Dispense error	Fixed bug that would cause systems to lock into current state
Hot tank temp rise error	Updated error limits to prevent false errors
Fan failure error limits	Updated error limits for proper function
Fan failure shutdown	Fixed bug that would prevent system shutdown
Hot tank thermistor error (0x35)	Fixed bug that could falsely report over-temp alarm when higher temperature setpoint is selected